
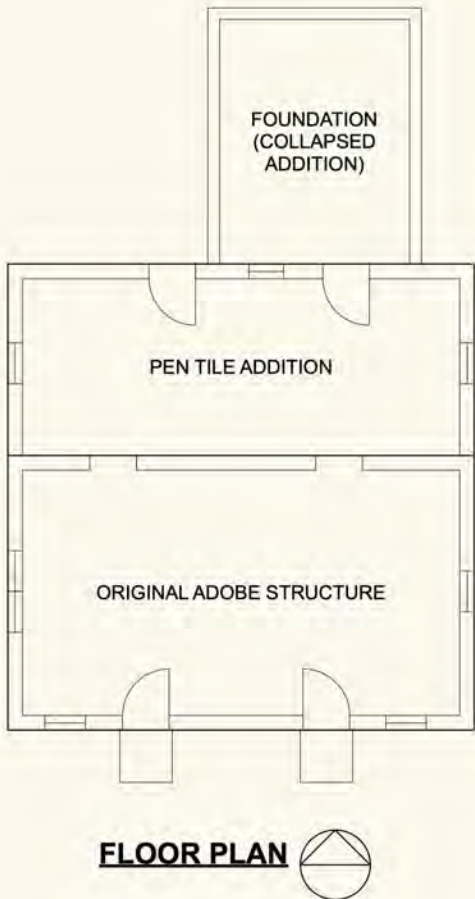


Historic Cultural Properties Inventory (HCPI) Base Form (FORM 1)

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria <u> </u> A <u> </u> B <u> </u> C <u> </u> D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #:
		4. County: Santa Fe Parcel #12129408
5. Property Type: Small single family residential structure on small city lot.		
6. Date of Survey: May 6, 2025, May 12, 2025		
7. Previous Survey Date(s): N/A		
8. Name of Project: HDRB Status Review		
9. Lat/Long: 35.689134, -105.950314		
10. Photo Information: May 12, 2025		View: Looking northeast from sidewalk
<p>11. Brief Description of the Property: This building is located in the City of Santa Fe, on a small city lot on West Alameda, in the Westside-Guadalupe Historic District. Early documentation on the property is scarce. Reportedly, the house was built in 1943, but no actual documentation of this exists. The building is a small, simple, low Pueblo Revival style structure, with a flat roof. It is approximately square, measuring about 26-1/2 feet in either direction. The exterior walls are constructed of adobe and pen tile. The setback, size, scale, style, and detailing of the building is somewhat typical of other buildings on the street. A small rectangular wood framed addition had been added to the north side of the building, but it collapsed in late 2024 or early 2025. All that remains of this addition is the foundation.</p> <p>Note: A detailed description of the property, and more documentation is included in the continuation sheets at the end of this document, beginning on page 5.</p>		
12. Who uses the property? Unused		
13. Construction Date: 1940's <u> </u> Known <u> </u> X <u> </u> Estimated	Source: MLS Listing, Property Recs (propertyrecs.com), Santa Fe County Clerk/Register of Deeds, City of Santa Fe GIS website, UNM Earth Data Analysis Center	
14. Setting: <u> </u> Suburban <u> </u> Rural <u> </u> Village <u> </u> X <u> </u> Urban If Urban: <u> </u> Commercial <u> </u> Industrial <u> </u> X <u> </u> Residential <u> </u> Public		
15. Relationship to Surroundings: <u> </u> X <u> </u> Similar <u> </u> Disimilar Comments: N/A		

16. Additional Perspective: (Photos, drawing, footprint, etc., indicate north arrow when possible)		17. Surveyor: Mark L Mortier – Architect 1936 Cerros Colorados Santa Fe, NM. 87501 505-231-5989 marklmortier@gmail.com
 <p style="text-align: center;">FLOOR PLAN</p>		18. Owner: Maxfield Scott, Santa Fe, NM:
19. Is Property Endangered? <input type="checkbox"/> Unknown <input type="checkbox"/> No <input checked="" type="checkbox"/> Yes How? Very weathered and deteriorated, vandalized, bottom of foundation is exposed, interior has been partially gutted, a portion of building has collapsed.		
20. Significance to Current Community: <input checked="" type="checkbox"/> Unknown <input type="checkbox"/> None <input type="checkbox"/> Low <input type="checkbox"/> Moderate <input type="checkbox"/> High Describe: Unknown		
21. Other Significance or Information of Interest (such as historical, legendary, structural, former ownership, etc.): The setback, size, scale, style, and detailing of the building is somewhat typical of other buildings on the street.		
22. National or State Register: Is this property individually listed on a historic register? <input type="checkbox"/> Unknown <input checked="" type="checkbox"/> No <input type="checkbox"/> Yes If yes: <input type="checkbox"/> State <input type="checkbox"/> National If 'no' or unknown, do you think this property is eligible for listing? <input checked="" type="checkbox"/> No <input type="checkbox"/> Yes Why? Unknown significance		
23. National or State Historic District: City of Santa Fe Is this property in a historic district? <input type="checkbox"/> Unknown <input type="checkbox"/> No <input checked="" type="checkbox"/> Yes If yes: <input type="checkbox"/> Significant <input type="checkbox"/> Contributing <input checked="" type="checkbox"/> Non-contributing If 'yes', what is the name of the district? <input type="checkbox"/> State <input type="checkbox"/> National <input checked="" type="checkbox"/> City of Santa Fe, Westside-Guadalupe Historic District		
24. Supplemental Forms: <input type="checkbox"/> None <input checked="" type="checkbox"/> HCPI Detail Form (FORM 2) <input type="checkbox"/> Continuation Sheets, # pages: <u>13</u>		

Historic Cultural Properties Inventory (HCPI) Detail Form (FORM 2)

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: Please complete HCPI FORM 1 before completing FORM 2 HCPI No. _____ District No. _____ NRHP _____ SRCP _____ Criteria <u> </u> A <u> </u> B <u> </u> C <u> </u> D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, and May 12, 2025
ARCHITECTURAL AND CONSTRUCTION DETAILS:		
6. Visible Construction Material: Exterior - Poured concrete foundations, adobe walls, pen tile walls, cement stucco, asphalt or modified bitumen built-up roof. Wood doors and windows. Interior - Wood joist floor structure, with wood flooring, Wood joist ceiling/roof structure, with wood decking, gypsum plastered walls. Note: Viga ends visible at front facade, as well as cut off stubs inside of the front portion of the building. Projecting roof/ceiling joists at rear façade. One modern sheet metal canale at rear, can see where two other canales were closed off for wood framed addition.		7. Number of Stories: 1
		8. Foundation: Shallow, board formed poured concrete foundation at portion of building still standing, top approximately level with grade, no footing; grout filled concrete block, on spread footing, at collapsed addition.
		9. Roof: Nominally flat roof, covered with modern asphalt or modified bitumen built-up roof, with mineral surfaced cap sheet, running over top of parapet.
10. Windows: Wood double hung type, single glazed, 1 light over 1 light. Simple wood frames with parting bead and applied stop. No counterbalances or weights - may have had pins to hold them open. Paint finish. Some windows have crude wood screens. Cast concrete sills. Also one square window opening on rear of building, window has been removed.	11. Doors: Front doors, frame and panel type with glazed flower petal design near top. May be hand made. May not be original. Stained finish. Simple painted wood frames, have been modified for doors. West rear door manufactured wood frame and panel door, with three horizontal panels and 4 light glazed panel. Wood frame. All painted. East rear door, modern hollow core door in crude wood frame.	
12. Chimneys: None.	13. Porches: None. Small poured concrete stoops at front doors.	
14. Other Significant Features: None		
15. Modifications: the building appears to have been built in three phases - first an original rectangular adobe walled portion located towards the front of property, then a rectangular "pen tile" addition on the back side of original portion, and finally a small addition on the back side of the pen tile addition. This last addition has collapsed, and only the foundation remains. Wood front doors appear to have been replaced.		

16. Primary Architectural Style: Spanish Pueblo Revival


17. Documents Available and Their Locations: Property Report - Property Recs (propertyrecs.com), Deeds and Plats - Santa Fe County Clerk/Register of Deeds, Aerial Photos, Map of Contributing Structures - City of Santa Fe GIS website, Aerial Photos - UNM Earth Data Analysis Center, Aerial Photos - Google Maps, Copies of MLS Listing - Owner.

SITE:

18. Attached or Associated Properties: None

Are associated properties eligible for listing: Not applicable

19. Site Plan:

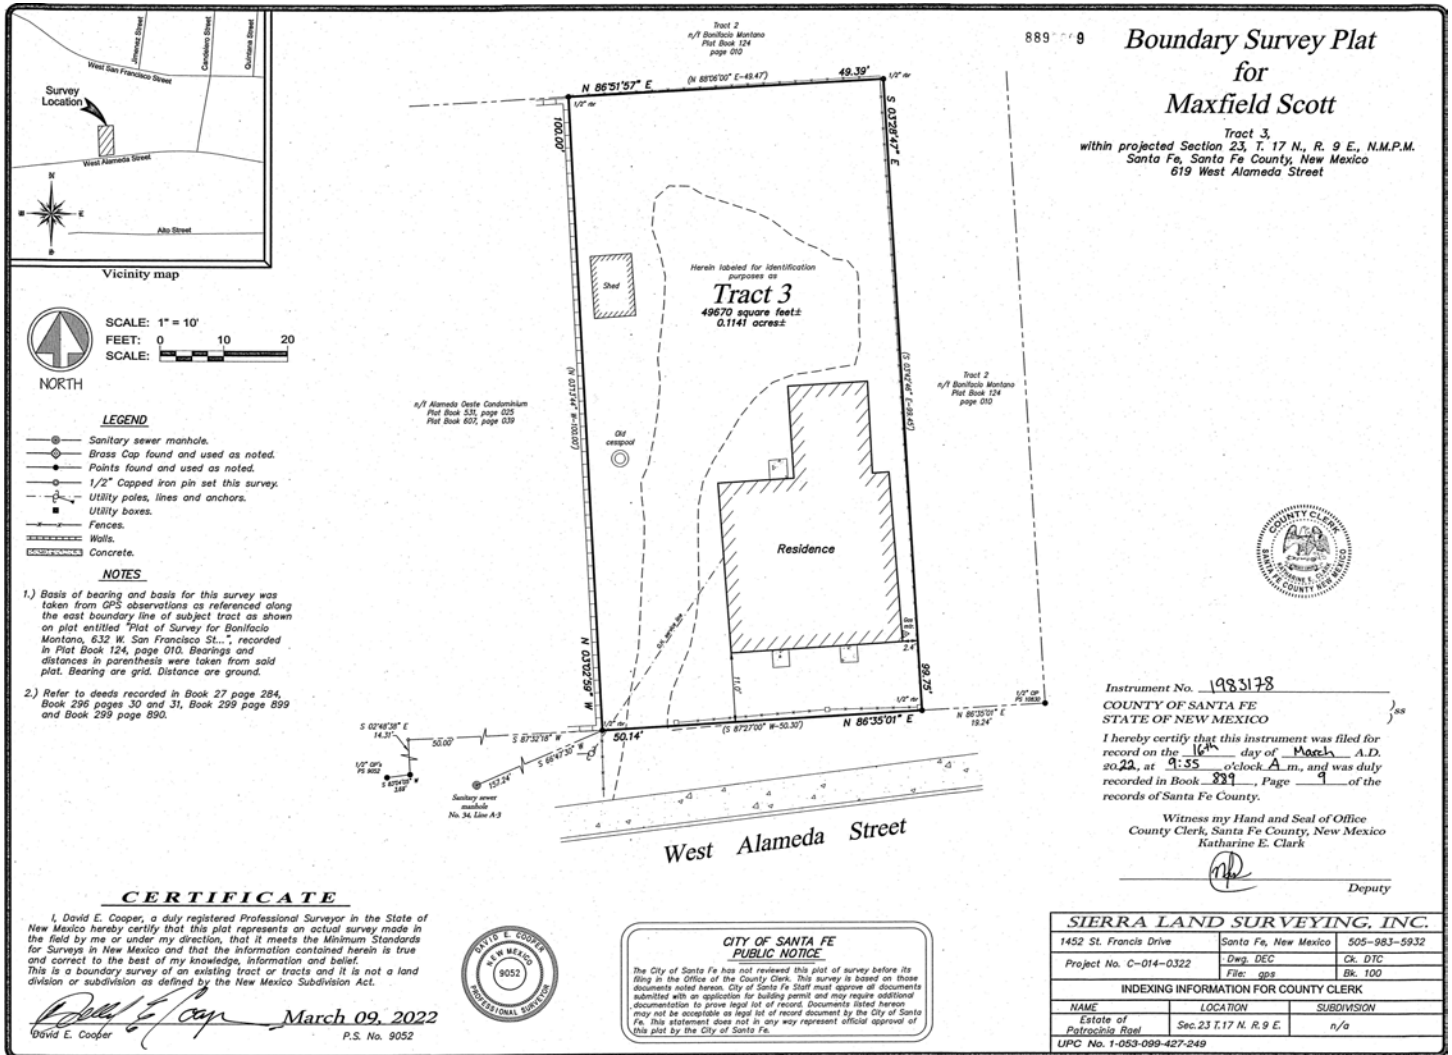

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only:		
HCPI No. _____	District No. _____	___NRHP ___SRCP Criteria ___A___B___C___D
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025

This building is located in the City of Santa Fe, on a small residential lot on West Alameda, in the Westside-Guadalupe Historic District. Early documentation on the property is scarce. Reportedly, the house was built in 1943, but no actual documentation of this exists. The earliest recorded deed for the property appears to be from 1945, conveying a 50-foot by 100-foot lot from a husband and wife living in Pilar, to a single owner in Santa Fe.

The building is a small, simple, low Pueblo Revival style structure, with a flat roof. It is approximately square, measuring about 26-1/2 feet in either direction. The setback, size, scale, style, and detailing of the building is somewhat typical of other older buildings on the street. A small rectangular wood framed addition had been added to the north side of the building, but it collapsed in late 2024 or early 2025. All that remains of this addition is the foundation.

The standing portion of the building appears to have been constructed in two phases – an original rectangular building on the front (south), and a full width rectangular addition on the back (north). A seam is visible on the side walls of the building, as well as a small step in the parapet height, where this addition joins the original building. The front half of the building, including the former north exterior wall, that now divides the two halves, was built with adobe blocks, on a shallow board formed poured concrete foundation, that was built without footings. The back half of the building was built with “pen tile,” also on a shallow board formed poured concrete foundation, built without footings. Both portions of the building have a flat roof/ceiling, framed with wood joists, and decked with wood boards. The roof appears continuous from above. Both halves have wood floor joists, over a shallow cavity, and were covered with wood flooring. The interior has been partially gutted.

Aerial photography, documenting the property, was obtained from the City of Santa Fe, the UNM Earth Data Analysis Center, and Google Maps. The earliest image, dated 1935, is too low resolution to be useful. A 1948 image is also low resolution, but appears to show a building on the property. However, its shape cannot be discerned. An image from 1951 clearly shows a building, which appears to be a square, suggesting the pen tile addition had been constructed by this time. The building footprint does not change in several photos from the 1960’s. The wood framed addition first shows up in a 1975 photo, and remains there in photos up to and including a dated May of 2023.

The exterior walls are covered with two layers of cement stucco, on chicken wire, which has been covered with a coat of thick paint or synthetic stucco. Each stucco layer has a visible cementitious color coat. An orange toned cementitious color coat, popular in the 1950’s and 1960’s, is seen just under the exterior coating, and a white cementitious finish coat is seen under that layer of stucco, on top of the base layer. The base layer of stucco has been applied directly to the substrate, without any building paper or other moisture barrier.

There are small, short projecting viga ends visible on the front façade of the building, which may be the remains of an original viga roof/ceiling structure for the front portion of the building. The stubs of the vigas can be seen on the interior of the front wall, and both sides of the rear wall of the original building, suggesting that the vigas have been cut off at the interior surface of the walls and removed. The rear façade has projecting roof/ceiling joists.

The roof appears to be covered with modern, mineral surfaced, asphalt or modified bitumen built up roofing, which has been run up and over the tops of the parapets. There is one modern sheet metal canale at the rear, you can see where two other canales were closed off for construction of the wood framed addition.

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025

All but one of the windows are wood, double hung type, single glazed, 1 light over 1 light. They are simply constructed with wood frames, and sashes held in place by an applied parting bead and applied stops, which form the tracks. They are not counter balanced or weighted, and may have had pins that were used to hold them open. Some of the windows have crude wood screens. The windows have a paint finish, and they appear to be original. The windows have cast concrete sills, and are recessed several inches into the walls, with a curved stucco reveal.

There is also a small square opening in the north wall, recessed similar to the double hung windows, with a painted wood frame, which appears to have been a wood window. The window appears to have been removed, and the opening is covered with wood framed window screening on the exterior, and what appears to be gypsum board on the interior. (This may be the back side of the bath tub surround. It is not weather proof, but was enclosed in the wood framed addition, until the addition collapsed.)

The two front windows, as well as the two windows on the east facade of the building, measure approximately 24-inches by 47-inches. Two of these same windows are mullied together on the south portion of the west façade to create a double unit. Another window on the north portion of the west façade measures approximately 30-inches by 45-inches.

The two front doors are wood, frame and panel type, with a glazed flower petal design. They do not appear to be original, and may be hand made. They appear to have been stained and sealed. There have simply constructed wood frames, with applied stops, a screen mortise, and wood sills, which appear to be set directly on the foundation. The frames are recessed several inches into the walls, with a curved stucco reveal. The frames have been crudely modified to accept the doors, and have a paint finish. The doors have modern latches and deadbolts, modern metal thresholds, and there are screen door hinges on the frames.

The western rear door, is a manufactured frame and panel door, with a 3 horizontal panels, and a glazed, 4 light panel in the top. The wood frame and sill are similar to the front doors, with provisions for a screen door. The frame is recessed several inches into the walls, with a curved stucco reveal. The door and frame have a paint finish. This door may be original. It has modern hardware, and a metal sill.

Another door is visible at the rear – on the east side. This door was installed to provide access into the rear addition. This door is a modern hollow core wood door, in a crude wood frame, that is set in a rough opening that was cut into the pen tile.

The building has electrical service, phone service, city water and sewer, and natural gas service, although none of these services are connected or in use.

On site features at the front of the property include the remains of a chain link fence, a couple of short cast concrete posts – which may be from an old fence, a couple of wood posts, and possible remains of a stone landscape border. There is a chain link fence along the east and north boundary of the property. The west boundary is closed off by walls on the adjacent property. There are two small poured concrete stoops outside of the two front doors.

There is also what appears to be an old pen tile lined well, on the west side of the property. Note that the survey shows a shed along the rear of the west boundary of the property. This shed no longer exists.

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



View from street – looking northeast - May 2025



South façade – looking north – May 2025

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____		
	__NRHP__SRCP	Criteria __A__B__C__D
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Southwest corner – looking northeast – May 2025



West façade – looking east – May 2025

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Northwest corner – looking southeast – May 2025



North façade – looking south – May 2025

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Northwest corner – looking north – May 2025



East façade – looking west – May 2025

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Southeast corner- looking northwest - May 2025

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____			__NRHP __SRCP	Criteria __A __B __C __D
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #		
		4. County: Santa Fe Parcel #12129408		
		5. Date of Survey: May 6, 2025, May 12, 2025		



Wood framed addition – pre collapse - 2023



Wood framed addition – pre collapse - 2023

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____			__NRHP__SRCP	Criteria __A__B__C__D
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #		
		4. County: Santa Fe Parcel #12129408		
		5. Date of Survey: May 6, 2025, May 12, 2025		



Aerial view – 1948 – appears to show a building on the property

Historic Cultural Properties Inventory (HCPI) Continuation Sheet
Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Aerial view - 1951 - appears to show a square building

Historic Cultural Properties Inventory (HCPI) Continuation Sheet
Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Aerial view - 1967 - clearly shows a square building

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Aerial view – 1975 – clearly shows the third addition

Historic Cultural Properties Inventory (HCPI) Continuation Sheet

Historic Preservation Division, New Mexico Department of Cultural Affairs

For HPD Office use only: HCPI No. _____ District No. _____ NRHP ___ SRCP ___ Criteria ___A___B___C___D		
1. Name of property: 619 West Alameda	2. Location: 619 West Alameda, Santa Fe, NM	3. Local Reference Number: Santa Fe ID #
		4. County: Santa Fe Parcel #12129408
		5. Date of Survey: May 6, 2025, May 12, 2025



Aerial View - 2023

6/24/85 HMW

SF

051613266

SFHD 7

2660


619 W. ALAMEDA

SF

SL

SFHD 7

22

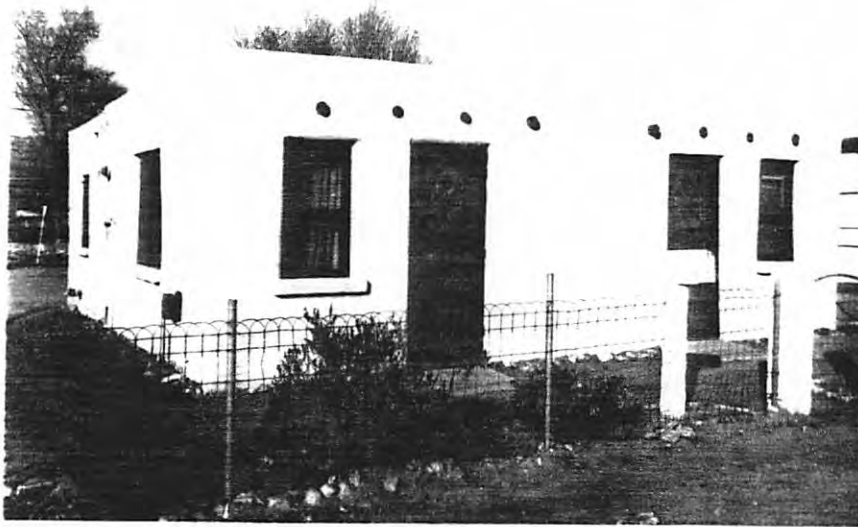

type of construction

P

SF DIR; NEIGHBOR

condition

excellent good
 fair deteriorating
 poor moderate other
 describe:

current use

RES.

similar to current use? similar not similar

historic potential

yes no

significance

significant of parts
 of visible, interior
 why?

associated buildings? yes
 what type?

if inventoried, list it as

on list? yes



City of Santa Fe
Land Use Department
200 Lincoln Ave.
Santa Fe, New Mexico 87504-0909

PROJECT 2025-010664-HDRB, 619 W Alameda St., Westside-Guadalupe Historic District,
DESC: non-contributing, Dura Build Construction, agent for Max Scott, owner, requests a historic status review with primary facade(s) designation, if applicable, for a residential structure.

CASE NUMBER: 2025-010664--HDRB

PROJECT TYPE: Historic Status Review

LOCATION: 619 W ALAMEDA ST
Santa Fe, NM 87501

CONTACTS: Applicant	Max Scott
Property Owner	Max Scott

BOARD ACTION

This is to certify that the Historic Districts Review Board (HDRB) acted on your request at their hearing on Jul 22, 2025. The decision of the Board was to upgrade the residential structure to contributing and designate the south and west facades as primary and designate the pentile lined well as contributing to the Westside-Guadalupe Historic District.

For further information please call 505-955-6605.

Sincerely,

Lani McCulley

NOTE: Applicant can use this action letter to apply for construction permit, but the permit shall not be released until the end of the appeal period which starts on the date of filing of the Findings and Conclusions in the City Clerk's office (SFCC 14-3.17(D)). Your permit will be denied if any changes on plans that were not approved by the HDRB or if conditions of approval are not met. **Please attach copies of this letter to all sets when submitting for construction permits.**



PURPOSE AND INSTRUCTIONS

Prior to a public hearing in front of the Historic District Review Board (HDRB) all applicants must obtain Historic Districts Preliminary Zoning Review (HPZR) from the Current Planning Division. The HPZR does not grant zoning approval. Following design approval from the HDRB, final zoning review will be performed at the time of building permit.

Applicants must submit complete and accurate information for review. Incomplete submittals will not be processed. All HPZR requests must be submitted to Current Planning via zoningcounter@santafenm.gov

PROJECT INFORMATION

Form with fields: Date (11/14/2025), Property Owner of Record (Maxfield Scott), Applicant/Agent Contact (Scott Irving), Site Address (619 W Alameda), Suite or Space #, Subdivision Name (N/A), Lot # Tract 3, Block #, Total Roof Area (square feet) 2200, Lot Coverage % 37%, Lot Size (square feet) 4967, Proposed Construction Description (Stabilize and repair existing 710ft. structure. Build rear unit.), The following documents are required for review as applicable: (Legal Lot of Record, Building Plans, Existing site plan w/ setbacks, Proposed site plan w/ setbacks, Existing & Proposed Elevations, Development Plan), Zoning District R29, Overlay Districts (Escarpment, Flood Plain, Other), Proposed Setbacks (Front 11ft, Rear 65ft, Left Side 20ft, Right Side 2.5ft), Required Setbacks (Front 7ft, Rear 15ft, Left Side 5ft, Right Side 5ft), Proposed Height 20'7", Max Height 10'4", Parking Required 3SPCS, Provided 3SPCS, Bike Parking Yes, Provided Yes

Historic Planning Case Manager Lani McCulley

If you selected "other," please write in the name of your case manager.

ADDITIONAL SUBMITTALS (IF APPLICABLE)

Form with checkboxes: Y N Affidavit Restricting Use of an Accessory Structure Containing a Bathroom or Kitchen, Y N Setback Affidavit and Agreement, Y N Site Visibility Triangle, Y N Escarpment Slope Analysis, Y N Flood Plain Grading Plan


This hereby certifies that the information provided for preliminary zoning review is accurate and will not be modified without consulting the Land Use Department staff prior to HDRB hearing.

Scott Irving Owner Applicant Agent

To Be Completed by Land Use Department Staff

PRELIMINARY REVIEW STATUS

Form with fields: Preliminarily Reviewed (checked), Reviewed w/ conditions, Denied, Comments/Conditions (must comply w/ Ch. 14 LDC at time of development), Preliminary Zoning Review completed by Rachael Hamilton, Date 12/09/2025, Preliminary Zoning Review # 2025-011663-PAR

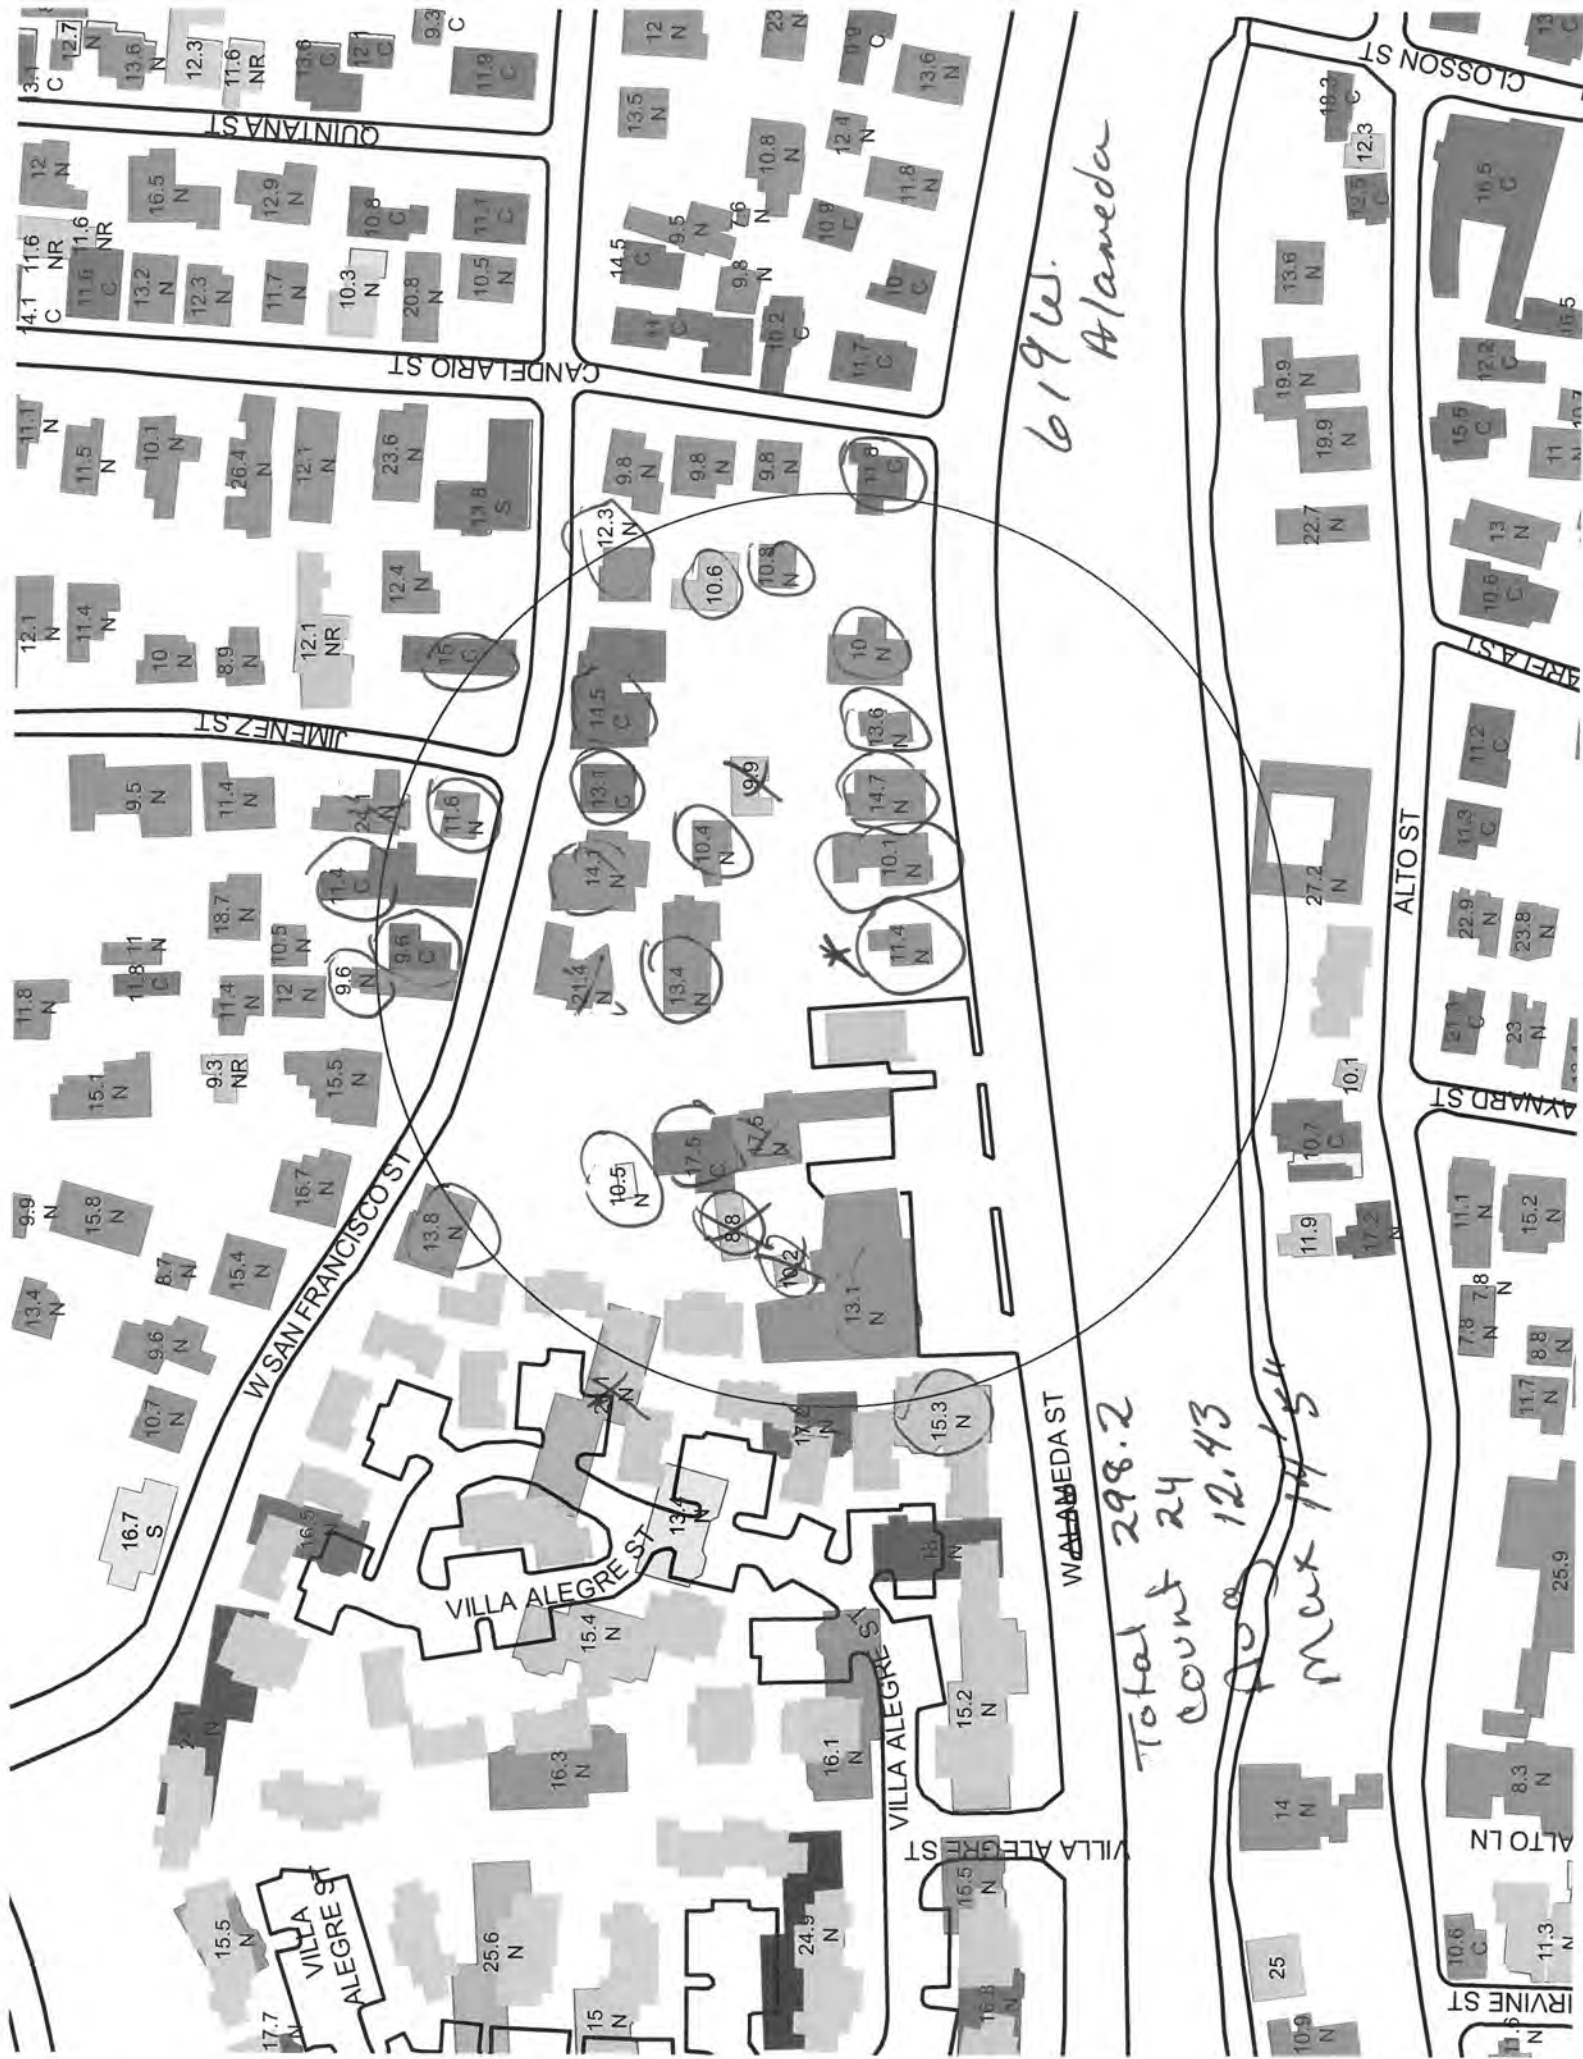

619 W. Alameda

Total 298.2
 count 24
 Avg 12.43
 Max 17.5

QUINTANA ST
 14.1 C NR
 11.6 C NR
 11.6 C NR
 13.2 N
 12.3 N
 11.7 N
 10.3 N
 20.8 N
 10.5 N
 11.1 C
 12 N
 16.5 N
 12.9 N
 10.8 C
 11.8 C
 12.7 N
 13.6 N
 12.3 N
 11.6 NR
 13.8 C
 12.1 C
 9.3 C
 11.8 C

JIMENEZ ST
 12.1 N
 11.4 N
 10 N
 8.9 N
 12.1 NR
 12.4 N
 11.8 S
 11.1 N
 11.5 N
 10.1 N
 26.4 N
 12.1 N
 23.6 N
 11.8 S

W SAN FRANCISCO ST
 11.8 N
 15.1 N
 9.3 NR
 11.4 N
 18.7 N
 12 10.5 N
 9.6 N
 9.6 C
 11.4 C
 24.1 N
 11.6 N
 11.8 11 C
 9.5 N
 11.4 N
 12.1 NR
 12.4 N
 15 C

VILLA ALEGRE ST
 16.7 S
 10.7 N
 9.6 N
 15.4 N
 16.7 N
 15.4 N
 13.8 N
 13.4 N
 10.4 N
 10.6
 10.8 N
 10.5 N
 14.7 N
 13.1 C
 14.5 C
 12.3 N
 9.8 N
 9.8 N
 9.8 N
 11.8 C
 10.1 N
 14.7 N
 13.6 N
 10 N
 11.4 N
 17.5 C
 17.6 N
 13.1 N
 10.2
 8.8

VILLA ALEGRE ST
 15.5 N
 17.7 N
 15.4 N
 16.3 N
 16.1 N
 15.2 N
 15.3 N
 13.1 N
 17.6 N
 13.1 N
 15.3 N

VILLA ALEGRE ST
 15.5 N
 25.6 N
 24.5 N
 15 N
 15.5 N
 16.8 N
 15.2 N

14.5 C
 9.5 N
 9.8 N
 10.2 C
 10.8 N
 12.4 N
 10.9 C
 11.8 N
 10.8 N
 12.4 N
 13.6 N
 12 N
 25 N
 10.9 C
 13.6 N

12.1 N
 11.4 N
 10 N
 8.9 N
 12.1 NR
 12.4 N
 11.8 S
 11.1 N
 11.5 N
 10.1 N
 26.4 N
 12.1 N
 23.6 N
 11.8 S

11.8 N
 15.1 N
 9.3 NR
 11.4 N
 18.7 N
 12 10.5 N
 9.6 N
 9.6 C
 11.4 C
 24.1 N
 11.6 N
 11.8 11 C
 9.5 N
 11.4 N
 12.1 NR
 12.4 N
 15 C

16.7 S
 10.7 N
 9.6 N
 15.4 N
 16.7 N
 15.4 N
 13.8 N
 13.4 N
 10.4 N
 10.6
 10.8 N
 10.5 N
 14.7 N
 13.1 C
 14.5 C
 12.3 N
 9.8 N
 9.8 N
 9.8 N
 11.8 C
 10.1 N
 14.7 N
 13.6 N
 10 N
 11.4 N
 17.5 C
 17.6 N
 13.1 N
 10.2
 8.8

15.5 N
 17.7 N
 15.4 N
 16.3 N
 16.1 N
 15.2 N
 15.3 N
 13.1 N
 17.6 N
 13.1 N
 15.3 N

15.5 N
 25.6 N
 24.5 N
 15 N
 15.5 N
 16.8 N
 15.2 N

CLOSSON ST
 19.9 N
 19.9 N
 22.7 N
 13.6 N
 18.2 C
 12.3 C
 12.5 C

ALTO ST
 27.2 N
 10.1 N
 11.9 N
 10.7 C
 17.2 N
 27.2 N

AYWARD ST
 21.1 C
 22.9 N
 23 N
 23.8 N
 11.2 C
 11.3 C
 10.6 C
 13 N
 15.5 C
 12.2 C
 11 N
 10.7

ALTO LN
 7.8 N
 7.8 N
 11.1 N
 15.2 N
 11.7 N
 8.8 N
 25.9

IRVINE ST
 10.6 C
 11.3 N
 14 N
 10.9 N
 25

10.6 C
 11.3 N
 14 N
 10.9 N
 25